SANDIA REPORT

SAND93—1373 • UC—405 Unlimited Release Printed July 1993



GENSHELL: A Genesis Database 2D to 3D Shell Transformation Program

Gregory D. Sjaardema

Prepared by
Sandia National Laboratories
Albuquerque, New Mexico 87185 and Livermore, California 94550
for the United States Department of Energy
under Contract DE-AC04-76DP00789



825227698

SANDIA NATIONAL LABORATORIES TECHNICAL LIBRARY Issued by Sandia National Laboratories, operated for the United States Department of Energy by Sandia Corporation.

NOTICE: This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors, or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government, any agency thereof or any of their contractors or subcontractors. The views and opinions expressed herein do not necessarily state or reflect those of the United States Government, any agency thereof or any of their contractors.

Printed in the United States of America. This report has been reproduced directly from the best available copy.

Available to DOE and DOE contractors from Office of Scientific and Technical Information PO Box 62 Oak Ridge, TN 37831

Prices available from (615) 576-8401, FTS 626-8401

Available to the public from
National Technical Information Service
US Department of Commerce
5285 Port Royal Rd
Springfield, VA 22161

NTIS price codes Printed copy: A03 Microfiche copy: A01

GENSHELL: A Genesis Database 2D to 3D Shell Transformation Program

Gregory D. Sjaardema
Solid and Structural Mechanics Department
Sandia National Laboratories
Albuquerque, New Mexico 87185

Abstract

GENSHELL is a three-dimensional shell mesh generation program. The threedimensional shell mesh is generated by mapping a two-dimensional quadrilateral mesh into three dimensions according to one of several types of transformations: translation, mapping onto a spherical, ellipsoidal, or cylindrical surface, and mapping onto a user-defined spline surface. The generated three-dimensional mesh can then be reoriented by offsetting, reflecting about an axis, revolving about an axis, and scaling the coordinates. GENSHELL can be used to mesh complex three-dimensional geometries composed of several sections when the sections can be defined in terms of transformations of two-dimensional geometries. The code GJOIN is then used to join the separate sections into a single body. GENSHELL updates the EXODUS quality assurance and information records to help track the codes and files used to generate the mesh. GENSHELL reads and writes twodimensional and three-dimensional mesh databases in the GENESIS database format; therefore, it is compatible with the preprocessing, postprocessing, and analysis codes in the Sandia National Laboratories Engineering Analysis Code Access System (SEACAS).

Intentionally Left Blank

Contents

1	Int	roduction	7
	1.1	SEACAS Mesh Generation Toolbox	7
	1.2	Introduction to the GENESIS File Format	9
	1.3	Overview of Capabilities in GENSHELL	9
	1.4	Organization of Report	
2	Coi	mmand Input	11
	2.1	Mesh Transformation	
	2.2	Mesh Orientation	18
	2.3	Modification or Creation of Material, Nodeset, or Sideset IDs	
	2.4	Information and Processing	
	2.5	Order of Transformation	
3	GE	NSHELL Example Input and Output	25
4	Ref	ferences	27
		e GENESIS Database Format	
В	Co	mmand Summary	31
C	GE	NSHELL Details	35
F	<u>'igur</u>	<u>res</u>	
F	igure	2 1. Schematic of SEACAS Mesh Generation Process	7
F	igure		
	igure		
	igure		15
	igure		
	igure		19
	igure		
	igure	· · · · · · · · · · · · · · · · · · ·	

Intentionally Left Blank

1 Introduction

GENSHELL is a mesh generation program that creates a three-dimensional shell mesh by transforming a two-dimensional mesh. Four transformations are available: (1) translating normal to the plane of the two-dimensional mesh, (2) mapping the two-dimensional mesh onto a spherical or ellipsoidal surface, (3) mapping the two-dimensional mesh onto a cylindrical surface, and (4) mapping the two-dimensional mesh onto a user-defined spline surface. GENSHELL is one of the mesh generation tools in the Sandia National Laboratories Engineering Analysis Code Access System (SEACAS) [1].

1.1 Sandia Engineering Analysis Code Access System Mesh Generation Toolbox

GENSHELL is typically used with the other SEACAS mesh generation codes FASTQ [2], GEN3D [3], GREPOS [4], GJOIN [5], and Aprepro [6]. Figure 1 shows the structure of the SEACAS mesh generation toolbox. The basic premise underlying this toolbox is that complicated geometries can be generated using a set of small specialized codes.

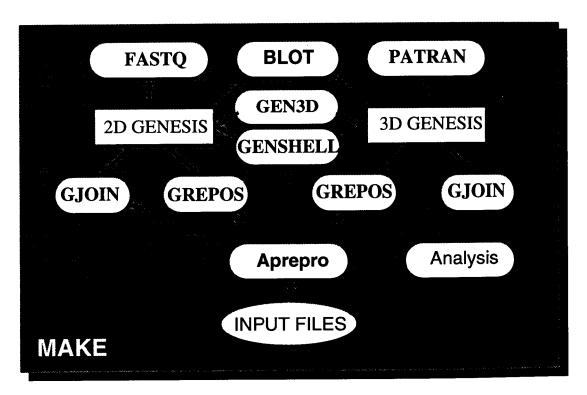


Figure 1. Schematic of SEACAS Mesh Generation Process

Each of these codes has a specialized purpose. A short synopsis of each code is given below. For more information consult the referenced documentation.

GEN3D Transforms a two-dimensional GENESIS database into a three-dimensional GENESIS database. Several

transformations are supported, and additional transformations can be easily added.[3]

GREPOS Transforms the geometry of a GENESIS database by scaling,

mirroring, offsetting, or rotating. It can also modify the database by deleting or renaming material blocks, sideset

identifications, or nodeset identifications.[4]

GJOIN Join together two or more GENESIS databases into a single

GENESIS database.[5]

FASTQ Interactive two-dimensional finite element mesh generation

program. Includes several mesh generation options

including paving.[2]

APREPRO An algebraic preprocessing program used to parameterize

finite element analyses. Includes a unit conversion system

and material database access routines.[6]

GENSHELL Transforms a two-dimensional GENESIS database into a

three-dimensional shell GENESIS database. Several

transformations are supported and additional

transformations can be easily added.

NUMBERS Calculates several properties of an EXODUS file, including

mass properties, timesteps, condition numbers, cavity

volumes, and others.[7]

BLOT The primary graphical two-dimensional and three-

dimensional postprocessing code. It includes deformed mesh plots, contour plots, shaded fringe plots, variable-versus-variable, time history, and distance-versus-variable plots. [8]

The SEACAS mesh generation toolbox is a simpler approach to three-dimensional mesh generation than the automatic and general-purpose programs that are available from commercial vendors. Many complicated three-dimensional geometries are composed of several primitives that can be defined in terms of transformations of two-dimensional geometries. Each of the primitives can be meshed using FASTQ, GEN3D, and GENSHELL, and then joined together using GJOIN.

This approach does; however, have some inherent difficulties. The biggest being managing and synchronizing several related files. For example, the meshes for some large problems can require more than one hundred files containing FASTQ, GEN3D, GENSHELL, GJOIN, and GREPOS input files; temporary GENESIS files; and parameter files. Manually building and modifying a mesh this complicated is obviously very difficult and time consuming. This problem has typically been minimized at Sandia National Laboratories, Albuquerque, New Mexico through the use of the UNIX* make† program and Aprepro. Make is used to build a set of dependencies between the various pieces of the finite element

^{*} UNIX is a registered trademark of UNIX Systems Laboratories Inc.

model. The analyst can then change files as needed and simply type make mesh to generate the mesh. If the dependencies have been entered correctly, make will rebuild only those portions of the mesh that are affected by the changed file. The synchronization problem (that is, ensuring that all of the separate pieces have compatible dimensions and discretization) is typically solved by creating a few parameter files which contain key dimensions and discretization information. Aprepro is then used to preprocess the input files and insert the key dimensions and discretization information into the input files.

1.2 Introduction to the GENESIS File Format

The GENESIS mesh database file format is the geometry definition portion of the EXODUS database file format used in the Engineering Sciences Center at Sandia National Laboratories. All of the mesh generation programs in the Engineering Sciences Center read and write files in the GENESIS format, which allows great flexibility in the choice of mesh generation, file translation, and graphical processing.

The GENESIS file contains the data to describe a finite element mesh including the location of the nodal points, the connectivity of the nodes that form each element, the material types of each element, and the boundary condition data which are used to specify load application points and nodal constraints. The reader is referred to References [9] and [10] for more information.

1.3 Overview of Capabilities in GENSHELL

With GENSHELL, the user can create a three-dimensional shell mesh by transforming a two-dimensional mesh; change the orientation and size of the resulting three-dimensional mesh; and change material block, nodeset, and sideset IDs. GENSHELL also updates the EXODUS QA and information records to help track the codes and files used to generate the mesh.

Transformations:

The three-dimensional shell mesh can be transformed by translation of a two-dimensional mesh, or by mapping a two-dimensional mesh onto a spherical, cylindrical, ellipsoidal, or user-defined spline surface.

Orientation:

The orientation of the mesh can be changed by revolving, offsetting, reflecting, zeroing, and scaling the nodal coordinates of the original mesh.

Material Blocks, Sidesets, and Nodesets:

In the SEACAS system, material properties are input according to material block IDs. Similarly, boundary conditions are associated with sideset and nodeset IDs. The input material block IDs, sideset IDs, and nodeset IDs can be changed to a new unique ID (that is they can be changed, but not combined).

[†] See your UNIX documentation for more information on make. Typically this is done by entering the command man 1 make

The user may also create sets of the nodes on the front and/or back of the three-dimensional mesh. The front or back nodeset contains all of the two-dimensional nodes. The front or back sideset also contains all of the two-dimensional nodes; however, the connectivity of the sideset is such that the right-hand-rule specifies the normal of the front sideset and the reverse holds for the back sideset.

Quality Assurance (QA) and Information Records:

A QA record for the GENSHELL program is added to the input QA record(s), and the filename of the input file is added to the information records that are written to the output mesh. The information record is prefaced by GENSHELL to help in identification. These records, explained in Reference [9], are useful in tracing the evolution of a mesh during the mesh generation process.

Node and Element Numbering:

The node and element numbering of the generated three-dimensional mesh is the same as the input two-dimensional mesh.

Element Attributes:

The generated three-dimensional shell elements have a single element attribute which specifies the thickness of the shell. This attribute is set by the transformation commands to the user-specified thickness.

1.4 Organization of Report

The remainder of this report is organized as follows:

- Chapter 2 describes the command input and valid commands, and
- Chapter 3 presents a few short examples illustrating *GENSHELL* use.

Three appendices are contained in this report.

- Appendix A is a code segment defining the GENESIS binary database format,
- Appendix B is a summary of the commands in GENSHELL, and
- Appendix C describes the specifics of *GENSHELL* including procurement, compilation, execution, and quality assurance.

2 Command Input

The user directs the execution of *GENSHELL* by entering commands to set processing parameters. The commands are in free-format and must adhere to the following syntax rules.

- Valid delimiters are a comma or one or more blanks.
- Either lowercase or uppercase letters are acceptable, but lowercase letters are converted to uppercase.
- A "\$" character in any command line starts a comment. The "\$" and any characters following it on the same line are ignored.
- A command may be continued over several lines with an "*" character. The "*" and
 any characters following it on the current line are ignored and the next line is
 appended to the current line.

Each command has an action keyword or "verb" followed by a variable number of parameters.

An action keyword or verb is a character string matching one of the valid commands. It may be abbreviated as long as enough characters are used to distinguish it from other commands.

The meaning and type of the parameters depend on the command verb. Most parameters are optional. If an optional parameter field is blank, a command-dependent default value is supplied. Valid entries for parameters are:

- A numeric parameter may be a real number or an integer. A real number may be in any legal FORTRAN numeric format (e.g., 1, 0.2, -1E-2). An integer parameter may be in any legal integer format*.
- A string parameter is a literal character string. Most string parameters may be abbreviated.

The notation conventions used in the command descriptions are:

- The command verb is in **bold** type.
- A literal string is in all uppercase SANSERIF type and should be entered as shown (or abbreviated).
- The value of a numeric parameter is represented by the parameter name in *italics*.
- A literal string in square brackets ("[]") represents a parameter option which is omitted entirely (including any following comma) if not appropriate. These parameters are distinct from most parameters in that they do not require a comma

^{*} Arithmetic equations, variables, and control structures can be used in the input files if the -aprepro option is used. See the Aprepro manual for more information.

as a place holder to request the default value.

• The default value of a parameter is in angle brackets ("<>"). The initial value of a parameter set by a command is usually the default parameter value. If not, the initial setting is given in the command description.

2.1 Mesh Transformation

TRANSLATE thickness <1.0>

TRANSLATE sets the thickness of the 3D shell mesh to *thickness*. This command supersedes previous transformation commands. The following command sets the thickness of the generated shell elements to 1.5:

TRANSLATE 1.5

All of the X and Y coordinates remain the same as those in the 2D mesh; the Z coordinates are set equal to 0.0

WARP POINT thickness <1.0>, radius <no default>

WARP POINT causes the 2D mesh to be mapped onto a spherical surface to create the 3D mesh. The spherical surface has a radius of curvature equal to radius. The center of curvature is located on the z-axis, and it is a distance of radius above the X-Y plane. The total thickness is thickness. Note that radius must be greater than the maximum distance from the z-axis to the boundary of the 2D mesh. This command supersedes previous transformation commands. The mesh transformation is performed in two parts. First, the warped nodal positions (xw, yw, zw) are calculated by mapping the original 2D mesh onto a spherical surface with a radius of curvature equal to radius. The original x and y coordinates of the 2D mesh remain at the same values; the z coordinate is calculated such that the distance to the center of curvature is equal to radius.

$$x_{w} = x_{2D}$$

$$y_{w} = y_{2D}$$

$$z_{w} = radius - \sqrt{radius^{2} - x_{2D}^{2} - y_{2D}^{2}}$$

The warped nodal positions are projections parallel to the z-axis onto a spherical surface of radius *radius*. A square mesh warped with the command "WARP POINT 1 2" is shown in Figure 2.

WARP XAXIS [MAPIVERTICAL] thickness <1.0>, radius <no default> WARP YAXIS [MAPIVERTICAL] thickness <1.0>, radius <no default>

This second form of the WARP command maps the 2D mesh to a cylindrical surface centered on either the X or Y axis. The cylindrical surface has a radius of curvature equal to *radius*. The center of curvature is located a distance of *radius*

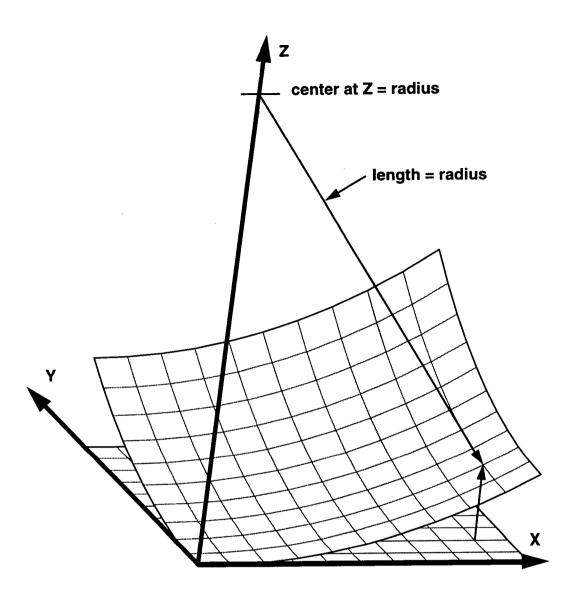


Figure 2. Illustration of WARP POINT transformation

above the X-Y plane. The total thickness is *thickness*. This command supersedes previous transformation commands.

If MAP is specified, the warped nodal positions (xw, yw, zw) are calculated by mapping the original 2D mesh onto a cylinder about the specified axis with a radius of curvature equal to radius. If YAXIS is specified, then the original Y-coordinate remains at the same value. The generated X and Z coordinates are calculated such that the distance from the generated node to the Y-Z plane measured along the cylindrical surface is equal to the X coordinate of the node in the 2D mesh. If the X-axis is specified, the X's and Y's are switched in the above discussion. The resulting 3D mesh will have an cylindrical angle of $x_{max}/radius$ radians if warped about the Y axis, or $y_{max}/radius$ radians if warped about the

X axis, where x_{max} and y_{max} are the maximum X and Y coordinates in the 2D mesh. A square mesh warped with the command "WARP YAXIS MAP 1 1" is shown in Figure 3. Note that the MAP options preserves element side lengths.

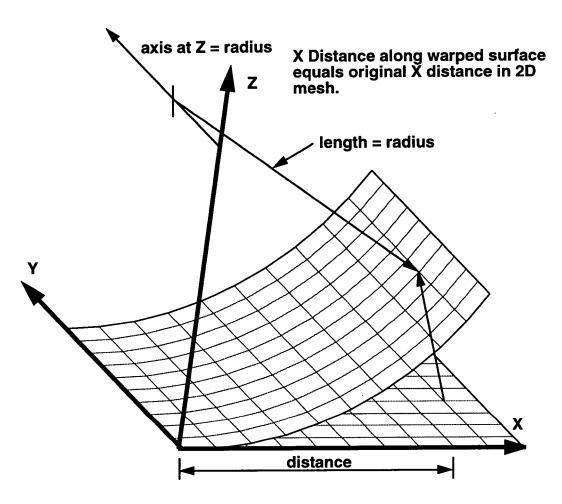


Figure 3. Illustration of WARP YAXIS MAP transformation

If VERTICAL is specified, the warped nodal positions (xw, yw, zw) are again calculated by mapping the original 2D mesh onto a cylinder about the specified axis with a radius of curvature equal to radius. However, for this case, both the original X- and Y-coordinates remain at the same value and the Z-coordinate is calculated as:

$$z_w = radius - \sqrt{radius^2 - y_{2D}^2}$$
 (1)

for an XAXIS warp. The y is replaced by x if a YAXIS warp is specified. A square mesh warped with the command "WARP YAXIS VERTICAL 1 1" is shown in Figure 4. Note that since the original X and Y coordinates remain the same in the transformed mesh, the elements elongate in the mapped mesh.

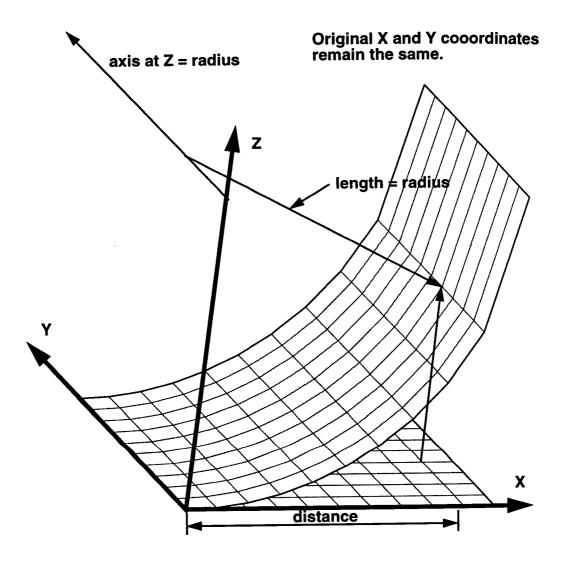


Figure 4. Illustration of WARP YAXIS VERTICAL transformation

WARP ELLIPSE, thickness <1.0>, xfactor, yfactor, zfactor

WARP ELLIPSE maps the 2D mesh onto an ellipsoidal surface defined by the equation:

$$\frac{x^2}{xfactor^2} + \frac{y^2}{yfactor^2} + \frac{z^2}{zfactor^2} = 1$$
 (2)

and sets the thickness of the generated mesh to *thickness*. The input X and Y-coordinates from the two-dimensional mesh remain the same and the Z-coordinate is calculated as:

$$z = z factor \times \sqrt{1 - \frac{x^2}{x factor^2} - \frac{y^2}{y factor^2}}$$
 (3)

A square mesh warped with the command "WARP ELLIPSE 0.1 2 3 4" is shown in Figure 5. Note that xfactor and yfactor must be chosen with care to avoid calculating a negative square root in Equation 3.

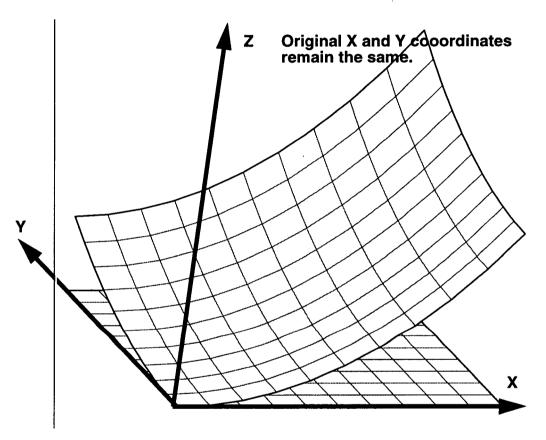


Figure 5. Illustration of WARP ELLIPSE transformation

SPLINE thickness <1.0>

SPLINE maps the 2D mesh onto a user-defined spline surface and sets the thickness of the generated mesh to *thickness*. The spline curved is defined in the X-Z coordinate plane and is then swept about the Z-axis to generate the spline surface. Following the SPLINE command line, *GENSHELL* enters the spline input mode in which the various spline options described below can be entered.

LINEAR—the spline data are input as Radius-Z data pairs, and the slopes at the end of the curves are linear slopes.

ANGULAR—the spline data are input as Theta(degrees)-Distance data pairs, where Theta is the angle between the X-Y plane and the line between the origin

(X = Y = Z = 0) and the defined point, and Distance is the length of this line. The slopes at the end of the curves are relative to this curve.

FRONT—the curve data and slope specifications up to the next BACK, END, or EXIT command will be for the FRONT spline. The front surface Z values are greater (more positive) than the back surface Z values. NOTE: In GENSHELL, only the front spline data are used, the BACK keyword is retained so that spline definitions from GEN3D files can be used in GENSHELL.

BACK—In *GENSHELL*, only the front spline data are used, the BACK keyword is retained so that spline definitions from *GEN3D* files can be used in *GENSHELL*.

LEFT slope—the parameter slope specifies the slope of the spline curve at the LEFT end of the curve. The slope is measured in the same units specified in the ANGULAR or LINEAR command. If the slope is not specified, the end conditions of the curve will be set such that the second derivative is equal to zero which is the so-called natural cubic spline.

RIGHT slope—the parameter slope specifies the slope of the spline curve at the RIGHT end of the curve. The slope is measured in the same units specified in the ANGULAR or LINEAR command. If the slope is not specified, the end conditions of the curve will be set such that the second derivative is equal to zero which is the so-called natural cubic spline.

SPHERICAL—The spline surface is swept *about* the Z-axis to generate the surface onto which the two-dimensional mesh is mapped. This is the default.

XSWEEP—The spline surface is swept *along* the X-axis to generate the surface onto which the two-dimensional mesh is mapped. The X-coordinates in the generated mesh are the same as the X-coordinates in the original mesh. The spline surface is input as either Y-Z data pairs if LINEAR is selected, or as Theta(degrees)-Distance pairs in the Y-Z plane if ANGULAR is selected.

YSWEEP—The spline surface is swept *along* the Y-axis to generate the surface onto which the two-dimensional mesh is mapped. The Y-coordinates in the generated mesh are the same as the Y-coordinates in the original mesh. The spline surface is input as either X-Z data pairs if LINEAR is selected, or as Theta(degrees)-Distance pairs in the X-Z plane if ANGULAR is selected.

EXIT or **END**—terminate spline input mode and return to general *GENSHELL* command processing.

GENSHELL does not check the validity of the input spline curve; it is possible to generate a mesh with invalid elements if the spline curve crosses itself.

The following procedure is used to generate a three-dimensional shell mesh from a two dimensional mesh using the SPLINE option.

1. Generate the cubic spline parameters to fit the data entered by the user.

- 2. Calculate the cumulative chord lengths d_i of each segment of the spline. The chord length of each segment is calculated as the straight line distance between each of the entered data points. This is a good approximation for smooth curves, but it underestimates the distance for non-smooth curves. If the spline does not begin at the Z axis, the minimum distance of the spline is equal to the distance from the Z axis. Note that the minimum distance is equal to d_1 , and the maximum distance is equal to d_{NS} where NS is the number of points defining the curve.
- 3. Determine the minimum and maximum extent of the input two-dimensional mesh. If SPHERICAL is specified, the extents are radii measured form the point X=Y=0; if XSWEEP or YSWEEP are specified, the extents are simply the minimum and maximum coordinates. If the spline curve starts at 0.0, the minimum extent of the two-dimensional mesh is also set to 0.0
- 4. The two-dimensional mesh is mapped onto the spline surface such that the maximum mesh extent (m_{max}) is mapped to the outside edge of the spline surface, and the minimum mesh extent (m_{min}) is mapped to the inside edge of the spline surface. This mapping defines a coordinate transformation where the two-dimensional mesh is uniformly stretched or shrunk onto the spline surface. Note that the distance is measured along the spline surface. If SPHERICAL is specified, both the X- and Y-coordinates are transformed; however, the generated three-dimensional node will have the same polar angle in the X-Y plane as the original two-dimensional node. If XSWEEP is specified, only the Y-coordinates are transformed; and if YSWEEP is specified, only the X-coordinates are transformed.

Figures 6, 7, and 8 show a square mesh mapped onto SPHERICAL spline surface, an XSWEEP spline surface, and a YSWEEP spline surface, respectively.

THICKNESS thickness < 1.0>

THICKNESS sets the thickness of the generated shell elements to *thickness*. A mesh transformation command must be entered prior to this command. Subsequent mesh transformation commands override this value.

2.2 Mesh Orientation

MIRROR axis₁, axis₂,... <no default> MIRROR RESET <no reflections>

MIRROR causes the mesh to be reflected about a coordinate plane. Each axis parameter specifies which coordinates (X or Y or Z) will be modified. Reflections are performed after the mesh has been repositioned by the REVOLVE and OFFSET commands.

The MIRROR RESET command resets to no reflection.

Reflections are not cumulative, that is, if MIRROR X Y Y X is entered, only one X

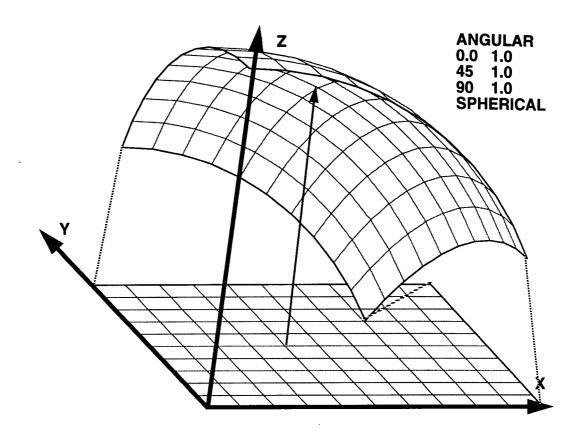


Figure 6. Illustration of SPLINE (SPHERICAL) transformation

and Y reflection will be performed. The element connectivity and the sideset face numbering will be correctly reordered.

```
OFFSET [ADD] axis_1, offset_1, axis_2, offset_2, ...
OFFSET [ADD] ALL offset < 0.0 >
OFFSET RESET <initial condition>
OFFSET xoff < 0.0 > yoff < 0.0 > zoff < 0.0 >
```

OFFSET specifies offsets to be added to the coordinates. If a REVOLVE command has been issued, the mesh is rotated before it is offset.

OFFSET ALL offsets all of the coordinates by the specified offset, and OFFSET RESET resets the offsets to zero.

If the optional keyword ADD is specified, offsets are cumulative, that is, if OFFSET ADD X 0.5 X 1.0 is entered, the X coordinates will be offset by 1.5. If ADD is omitted from the above line, the X coordinates will be offset by 1.0.

RANDOMIZE $axis_1$, $magnitude_1$, $axis_2$, $magnitude_2$, ... **RANDOMIZE ALL** magnitude < 0.0 >

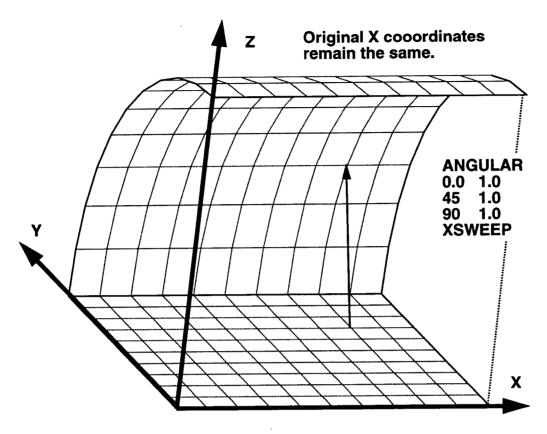


Figure 7. Illustration of SPLINE (XSWEEP) transformation

RANDOMIZE RESET <initial condition>

RANDOMIZE specifies random offsets to be added to the coordinates. If a REVOLVE command has been issued, the mesh is rotated before it is offset. The specified coordinates are offset by a random amount in the range from -magnitude to +magnitude.

RANDOMIZE ALL randomly offsets all of the coordinates by the specified magnitude, and RANDOMIZE RESET cancels the offsets.

If there are contact surfaces in the mesh description, the nodes on both surfaces will be moved using a different random offset; therefore, if the two surfaces are initially in contact, it is almost certain that they will overlap after they are randomized.

REVCEN xcen < min X> ycen < min Y> zcen <min Z>

REVCEN sets the center of revolution for the REVOLVE command to the point (xcen, ycen, zcen).

REVOLVE $axis_1$, $ndeg_1$, $axis_2$, $ndeg_2$, ... < last selection >

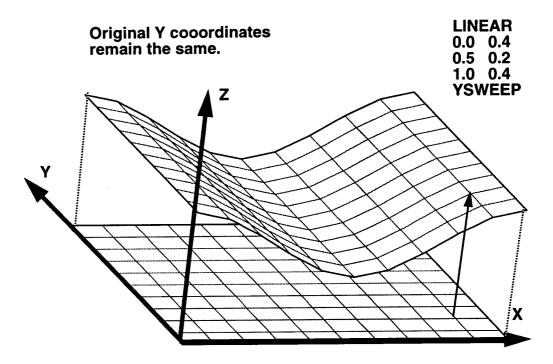


Figure 8. Illustration of SPLINE (YSWEEP) transformation

REVOLVE RESET < initial condition>

REVOLVE causes the mesh to be rotated. Each (axis_i, ndeg_i) parameter pair specifies an axis (X or Y or Z) and the number of degrees to rotate. The rotations are according to right-hand rule. The center of the rotation is specified by the REVCEN command.

Revolutions are cumulative and order-dependent; however, only one center of revolution (see REVCEN) may be specified. The REVOLVE RESET command resets to no rotation.

SCALE axis, scale, axis, scale, ... SCALE ALL scale_factor <1.0 > SCALE RESET <initial condition>

SCALE causes the specified coordinates of axis axis, to be multiplied by the scaling multiplier scale. The scaling multiplier must be greater than zero; the MIRROR command must be used with the SCALE command if a negative scaling multiplier is required. For example, SCALE X 2.54 followed by MIRROR X will scale the X coordinates by -2.54.

SCALE ALL multiplies all of the coordinates by the specified multiplier, and SCALE RESET resets to no scaling.

Scalings are cumulative, that is, if SCALE X 0.5×0.6 is entered, the X coordinates will be scaled by 0.3.

```
SHIFT [ADD] axis_1, shift_1, axis_2, shift_2, ...
SHIFT [ADD] ALL shift < 0.0 >
SHIFT RESET <initial condition>
SHIFT xoff < 0.0 > yoff < 0.0 > zoff < 0.0 >
```

SHIFT is simply a synonym for the OFFSET command. See the description of the OFFSET command for more information.

```
ZERO axis_1, min_1, axis_2, min_2, ...
ZERO ALL min
ZERO RESET <no automatic zeroing>
```

ZERO sets all axis, coordinates with an absolute value less than min, equal to zero. If ALL is specified, the minimum value is applied to all three coordinates. The ZERO RESET command resets to no automatic zeroing. This command is used to zero nodal coordinates that should be equal to zero, but due to roundoff errors they have slightly nonzero values.

2.3 Modification or Creation of Material, Nodeset, or Sideset IDs

NODESETSINSETS FRONTIBACK <no default>, set_id_1, set_id_2,...

NODESETS or NSETS defines front or back node sets with the given identifiers. The identifiers must be unique from existing node set identifiers and previously defined front and back node set identifiers. Back sets cannot be defined on a 360-degree rotation.

SIDESETSISSETS FRONT or BACK <no default>, set_id_1, set_id_2,...

SIDESETS is equivalent to the NODESETS command except that it defines side sets.

CHANGE MATERIALINODESETISIDESETINSETSISSETS old_id new_id

CHANGE changes the identification number old_id of a material block, nodeset, or sideset to new_id. The new_id must be unique, that is, CHANGE can only be used to change the identification number; it cannot be used to combine or delete identification numbers (use GJOIN to combine material blocks, sidesets, or nodesets).

2.4 Information and Processing

ENDIEXIT

END or EXIT ends the command input and starts the mesh transformation.

HELP command < general help>

HELP displays information about the program command given as the parameter.

If no parameter is given, all the command verbs are displayed. This command is system-dependent and may not be available on some systems.

LIST option

LIST displays information about the requested *option*. Valid options are: VARIABLES, VARS, and COMMANDS.

LIST {VARSIVARIABLES}

displays a summary of the database. The summary includes the database title; the number of nodes, elements, and element blocks; the number of node sets and side sets; and the number of each type of variable.

LIST COMMANDS

displays a list of the valid commands.

QUIT

QUIT ends the command input and exits the program immediately without writing an output database.

SHOW command <no parameter>

SHOW displays the settings of parameters relevant to the *command*. For example, the command SHOW REVOLVE displays information about the currently defined revolution.

SUMMARY

SUMMARY displays a short list of the command syntax for the mesh transformation, orientation, and modification commands.

2.5 Order of Transformation

Although GENSHELL commands may be entered in any order, the mesh transformation command is performed first followed by processing the orientation commands in the following order:

REVOLVE, OFFSET, MIRROR, RANDOMIZE, ZERO, SCALE

Processing of mesh transformation and orientation commands does not occur until an EXIT or END command is entered.

Unlike the transformation and orientation commands, the CHANGE operations are performed in the order they are entered, and at the time they are entered.

Intentionally Left Blank

3 GENSHELL Example Input and Output

A few examples of GENSHELL commands are shown below. In the examples below, lines beginning with the string "GenShell>" show the user input and the lines following are the GENSHELL output. Lines in *Italic* type indicate comment about the command or the output and will not appear during a run of GENSHELL.

FRONT

BOTTOM*

SPHERICA XSWEEP YSWEEP

BACK*

The following example generates the mesh shown in Figure 2.

```
Valid Commands:

LEFT RIGHT ANGULAR TOP
END EXIT LIST HELP

Spline Option > linear
Spline Option > front
Spline Option > 0.0 0.4
Spline Option > 0.5 0.2
Spline Option > 1.0 0.4
Spline Option > left 0.0
Spline Option > right 0.0
```

GenShell> spline 0.1

Spline Option > end
Spline mesh, thickness = .1000

Spline Option > xsweep Spline Option > show

GenShell> end

```
Database: tst.g

Square mesh for genshell examples

Number of coordinates per node = 3

Number of nodes = 121

Number of elements = 100

Number of element blocks = 1

Number of node sets = 0

Number of side sets = 0
```

Total length of top spline= 1.07703E+00, Proportion= 1.07703E+00

The next example shows a simple translation followed by several reorientation commands.

GenShell> translate .01

```
Translate mesh, thickness = 10.00E-3
```

GenShell> revolve x 30 y 30

```
Rotation matrix for generated mesh:
    .8660    .0000    -.5000
    .2500    .8660    .4330
    .4330    -.5000    .7500
```

GenShell> randomize z .01 x .001

Coordinate random factors = 1.00E-3 .00E-3 10.00E-3

GenShell> scale all 2.0

Coordinate scale factors = 2.000 2.000 2.000

GenShell> mirror x

New X = - Old X

GenShell> offset x 10 z -1

Coordinate offsets = 10.00 .00 -1.00

GenShell> change material 1 10

*** Material 1 changed to Material 10

GenShell> sideset front 100

IDs for INPUT side sets:

IDs for FRONT side sets: 100

IDs for BACK side sets:

GenShell> nodeset back 10

IDs for INPUT node sets:

IDs for FRONT node sets:

IDs for BACK node sets: 10

GenShell> zero x 1e-5 y 1e-5

Minimum nonzero coordinates = 10.00E-6 10.00E-6 .00E-6

GenShell> end

4 References

- [1] G. D. Sjaardema, "Overview of the Sandia National Laboratories Engineering Analysis Code Access System," Technical Report SAND92-2292, Sandia National Laboratories, Albuquerque, New Mexico, January 1993.
- [2] T. D. Blacker, "FASTQ Users Manual, Version 2.1," Technical Report SAND88–1326, Sandia National Laboratories, Albuquerque, New Mexico, July 1988.
- [3] A. P. Gilkey and G. D. Sjaardema, "GEN3D: A GENESIS Database 2D to 3D Transformation Program," Technical Report SAND89-0485, Sandia National Laboratories, Albuquerque, New Mexico, March 1989.
- [4] G. D. Sjaardema, "GREPOS: A GENESIS Database Repositioning Program," Technical Report SAND90-0566, Revision 1, Sandia National Laboratories, Albuquerque, New Mexico, June 1993.
- [5] G. D. Sjaardema, "GJOIN: A Program for Merging Two or More GENESIS Databases," Technical Report SAND92-2290, Sandia National Laboratories, Albuquerque, New Mexico, December 1992.
- [6] G. D. Sjaardema, "Aprepro: An Algebraic Preprocessor for Parameterizing Finite Element Analyses," Technical Report SAND92–2291, Sandia National Laboratories, Albuquerque, New Mexico, December 1992.
- [7] G. D. Sjaardema, "NUMBERS: A Collection of Utilities for Pre- and Postprocessing Two- and Three-Dimensional EXODUS Finite Element Models," Technical Report SAND88-0737, Sandia National Laboratories, Albuquerque, New Mexico, March 1989.
- [8] A. P. Gilkey, "BLOT—A Mesh and Curve Plot Program for the Output of a Finite Element Analysis," Technical Report SAND88–1432, Sandia National Laboratories, Albuquerque, New Mexico, June 1989.
- [9] W. C. Mills-Curran, A. P. Gilkey, and D. P. Flanagan, "EXODUS: A Finite Element File Format for Pre- and Post-processing," Technical Report SAND87–2977, Sandia National Laboratories, Albuquerque, New Mexico, September 1988.
- [10] L. M. Taylor, D. P. Flanagan, and W. C. Mills-Curran, "The GENESIS Finite Element Mesh File Format," Technical Report SAND86-0910, Sandia National Laboratories, Albuquerque, New Mexico, May 1986.
- [11] J. R. Red-Horse, D. P. Flanagan, and W. C. Mills-Curran, "SUPES Version 2.1: A Software Utilities Package for the Engineering Sciences," Technical Report SAND90-0247, Sandia National Laboratories, Albuquerque, New Mexico, May 1990.
- [12] B. Berliner, "CVS II: Parallelizing Software Development," in *Proceedings of the Winter 1990 USENIX Conference*, 1990.
- [13] "American National Standard Programming Language FORTRAN," Technical Report ANSI X3.9–1978, American National Standards Institute, Inc., New York, 1978.

Intentionally Left Blank

A The GENESIS Database Format

The following code segment reads a GENESIS database.

```
--Open the GENESIS database file
      NDB = 9
      OPEN (UNIT=NDB, ..., STATUS='OLD', FORM='UNFORMATTED')
C
    --Read the title
      READ (NDB) TITLE
       --TITLE - the title of the database (CHARACTER*80)
C
С
    --Read the database sizing parameters
      READ (NDB) NUMNP, NDIM, NUMEL, NELBLK,
     & NUMNPS, LNPSNL, NUMESS, LESSEL, LESSNL
       --NUMNP - the number of nodes
C
       --NDIM - the number of coordinates per node
C
       --NUMEL - the number of elements
С
С
       --NELBLK - the number of element blocks
C
       --NUMNPS - the number of node sets
C
       --LNPSNL - the length of the node sets node list
С
       --NUMESS - the number of side sets
       --LESSEL - the length of the side sets element list
C
       --LESSNL - the length of the side sets node list
C
С
    -- Read the nodal coordinates
      READ (NDB) ((CORD(INP, I), INP=1, NUMNP), I=1, NDIM)
С
    --Read the element order map (each element must be listed once)
      READ (NDB) (MAPEL(IEL), IEL=1, NUMEL)
C
    --Read the element blocks
      DO 100 IEB = 1, NELBLK
С
       -- Read the sizing parameters for this element block
         READ (NDB) IDELB, NUMELB, NUMLNK, NATRIB
         --IDELB - the element block identification (must be unique)
С
С
          --NUMELB - the number of elements in this block
С
               (the sum of NUMELB for all blocks must equal NUMEL)
С
          --NUMLNK - the number of nodes defining the connectivity
С
              for an element in this block
C
          --NATRIB - the number of element attributes for an element
С
               in this block
       --Read the connectivity for all elements in this block
C
         READ (NDB) ((LINK(J,I), J=1,NUMLNK, I=1,NUMELB)
C
       -- Read the attributes for all elements in this block
         READ (NDB) ((ATRIB(J,I), J=1,NATRIB, I=1,NUMELB)
 100 CONTINUE
    --Read the node sets
      READ (NDB) (IDNPS(I), I=1, NUMNPS)
       --IDNPS - the ID of each node set
      READ (NDB) (NNNPS(I), I=1, NUMNPS)
       --NNNPS - the number of nodes in each node set
C
      READ (NDB) (IXNNPS(I), I=1, NUMNPS)
C
       --IXNNPS - the index of the first node in each node set
С
           (in LTNNPS and FACNPS)
      READ (NDB) (LTNNPS(I), I=1,LNPSNL)
       --LTNNPS - the nodes in all the node sets
      READ (NDB) (FACNPS(I), I=1,LNPSNL)
```

```
--FACNPS - the factor for each node in LTNNPS
С
    --Read the side sets
      READ (NDB) (IDESS(I), I=1, NUMESS)
       --IDESS - the ID of each side set
C
      READ (NDB) (NEESS(I), I=1, NUMESS)
       --NEESS - the number of elements in each side set
      READ (NDB) (NNESS(I), I=1, NUMESS)
       --NNESS - the number of nodes in each side set
C
      READ (NDB) (IXEESS(I), I=1, NUMESS)
       --IXEESS - the index of the first element in each side set
С
C
            (in LTEESS)
      READ (NDB) (IXNESS(I), I=1, NUMESS)
       --IXNESS - the index of the first node in each side set
С
            (in LTNESS and FACESS)
C
      READ (NDB) (LTEESS(I), I=1, LESSEL)
       --LTEESS - the elements in all the side sets
С
      READ (NDB) (LTNESS(I), I=1, LESSNL)
       --LTNESS - the nodes in all the side sets
      READ (NDB) (FACESS(I), I=1, LESSNL)
       --FACESS - the factor for each node in LTNESS
```

A valid GENESIS database may end at this point or after any point described below.

```
-- Read the QA header information
      READ (NDB, END=...) NQAREC
       --NQAREC - the number of QA records (must be at least 1)
С
      DO 110 IQA = 1, MAX(1,NQAREC)
         READ (NDB) (QATITL(I, IQA), I=1,4)
          --QATITL - the QA title records; each record contains:
C
С
               1) analysis code name (CHARACTER*8)
               2) analysis code qa descriptor (CHARACTER*8)
С
               3) analysis date (CHARACTER*8)
C
               4) analysis time (CHARACTER*8)
  110 CONTINUE
    --Read the optional header text
      READ (NDB, END=...) NINFO
       --NINFO - the number of information records
C
      DO 120 I = 1, NINFO
         READ (NDB) INFO(I)
          --INFO - extra information records (optional) that contain
С
               any supportive documentation that the analysis code
С
               developer wishes (CHARACTER*80)
  120 CONTINUE
    --Read the coordinate names
      READ (NDB, END=...) (NAMECO(I), I=1, NDIM)
       --NAMECO - the coordinate names (CHARACTER*8)
C
    --Read the element type names
      READ (NDB, END=...) (NAMELB(I), I=1, NELBLK)
C
       --NAMELB - the element type names (CHARACTER*8)
```

B Command Summary

Mesh Transformation (page 12)

TRANSLATE thickness

translates the 2D mesh to create the 3D shell mesh.

WARP POINT thickness, radius

maps the 2D mesh onto a spherical surface.

WARP XAXIS [MAPIVERTICAL] thickness, radius WARP YAXIS [MAPIVERTICAL] thickness, radius

maps the 2D mesh onto a cylindrical surface.

WARP ELLIPSE thickness, xfactor, yfactor, zfactor

maps the 2D mesh onto an ellipsoidal surface.

SPLINE thickness

maps the 2D mesh onto a spline surface. Commands available are:

LINEARIANGULAR

FRONTIBACK

LEFT slope

RIGHT slope

SPHERICALIXSWEEPIYSWEEP

EXITIEND

THICKNESS, thickness

sets the thickness of the generated 3D mesh.

Mesh Orientation (page 18)

MIRROR axis₁, axis₂, ... MIRROR RESET

causes the mesh to be reflected about the specified axes, or resets the mesh to no reflections.

OFFSET [ADD] $axis_1$, $offset_1$, $axis_2$, $offset_2$, ... OFFSET [ADD] ALL offset OFFSET RESET

OFFSET xoff, yoff, zoff

specifies the coordinate offsets for the mesh, or resets the mesh to no offsets. Synonym for SHIFT command.

RANDOMIZE $axis_1$, $magnitude_1$, $axis_2$, $magnitude_2$, ... RANDOMIZE ALL magnitude RANDOMIZE RESET

randomly offset nodes.

REVCEN xcen, ycen, zcen

sets the center of rotation for the REVOLVE command.

REVOLVE $axis_1$, $ndeg_1$, $axis_2$, $ndeg_2$, ... REVOLVE RESET

causes the mesh to be rotated, or resets the mesh to no rotations.

SCALE $axis_1$, $scale_1$, $axis_2$, $scale_2$, ...
SCALE ALL $scale_factor$ SCALE RESET

causes the mesh to be scaled, or resets the mesh to no scaling.

SHIFT [ADD] $axis_1$, $offset_1$, $axis_2$, $offset_2$, ...
SHIFT [ADD] ALL offsetSHIFT RESET
SHIFT xoff, yoff, zoff

specifies the coordinate offsets for the mesh, or resets the mesh to no offsets. Synonym for OFFSET command.

ZERO $axis_1$, min_1 , $axis_2$, min_2 , ... ZERO RESET

sets all axis, coordinates with an absolute value less than min, equal to zero, or resets the mesh to no automatic zeroing.

Modification or Creation of Material, Nodeset, or Sideset IDs (page 22)

NODESETSINSETS FRONTIBACK set_id,...

define nodesets on front or back of generated 3D mesh.

SIDESETSISSETS FRONTIBACK set_id, ...

define sidesets on front or back of generated 3D mesh.

CHANGE MATERIALINODESETISIDESETINSETISSET old_id, new_id

change material, nodeset, or sideset identification numbers.

Information and Processing (page 22)

ENDIEXIT

terminate command input and start mesh processing.

HELP command

display information about the program command.

LIST option

display information about the program option.

QUIT

terminate command input and quit the program immediately.

SHOW command

display the settings of the parameters relevant to the specified command.

SUMMARY

display a short list of the command syntax for the mesh transformation, orientation, and modification commands.

Order of Orientation Processing (page 23)

Orientation commands are processed in the following order: REVOLVE, OFFSET, MIRROR, RANDOMIZE, ZERO, SCALE.

Intentionally Left Blank

C GENSHELL Details

Version:

The current version of GENSHELLis 1.6

Execution:

To execute GENSHELL on a UNIX* system (with SEACAS), type:

genshell [-options option] input_database output_database

Input_database is the filename of the input GENESIS database.

Output_database is the filename of the output GENESIS database

Valid options are:

- -executable = alternate-executable
 - to specify running a different version of GENSHELL,
- -aprepro to pipe the input through the program aprepro [6],
- -command=single-line-command to run grepos with just a single command given on the command line instead of interactively or in an input file.
- -help to get a usage synopsis,
- -VMS to indicate that the EXODUS file is in VAX/VMS binary format[†], and
- -IEEE to indicate that the EXODUS file is in IEEE binary format[‡].

User input is read from the terminal keyboard (unless redirected using '<'). User output is directed to the terminal.

Execution Files:

The table below summarizes GENSHELL file usage.

Description	Unit	Туре	File Format	
User input	std input	input	ASCII	
User output	std output	output	ASCII	
GENESIS database	9	input	GENESIS	
GENESIS database	10	output	GENESIS	

^{*} UNIX is a registered trademark of UNIX Systems Laboratories Inc.

[†] Cray Unicos systems only

[‡] Cray Unicos systems only

All files must be connected to the appropriate unit before *GENSHELL* is run. Each database file is opened with the name retrieved by the EXNAME routine of the *SUPES* [11] library.

Source Code:

The GENSHELL source code is maintained in the SEACAS system which is managed by the Concurrent Version System (cvs) [12]. GENSHELL is written in ANSI standard FORTRAN-77 [13] with the exception of the following extension:

• Include files are used.

GENSHELL uses the following software package:

- the SUPES [11] package which includes dynamic memory allocation, a free-field reader, and FORTRAN extensions.
- the SUPLIB package which is an undocumented internal development library which includes GENESIS reading and writing routines, command parsing, string utilities, and other miscellaneous useful functions.

Availability:

GENSHELL and all other SEACAS codes are available on a licensed basis. The license agreements for these codes stipulate that (1) the software is to be used solely for internal purposes, (2) the codes are not to be distributed or transferred to any person without written permission, (3) the codes are to be used at a single site and should be copied only for necessary maintenance, development, or backup purposes, and (4) there should be a procedure, or site plan, in place for protecting the provisions of the license agreements.

For more information on obtaining GENSHELL or other SEACAS codes, contact:

Marilyn K. Smith
Computational Mechanics and Visualization Department
Department 1425
Sandia National Laboratories
P.O. Box 5800
Albuquerque, New Mexico 87185-5800
(505) 844-3082, FAX: (505) 844-9297

ribu	tion	1	6411	A. S. Benjamin
		1	6423	J. F. Dempsey
1400	E. L. Barsis	1	6513	D. S. Oscar
1401	J. R. Asay	1	6522	J. D. Miller
1402		5	7141	Technical Library
1403	G. S. Davidson	1	7151	Technical Publications
1404	•	10	7613-2	Document Processing
1425				for DOE/OSTI
1425		1	8523-2	Central Technical Files
1431	J. M. McGlaun	6	8741	G. A. Benedetti & staff
1431	K. G. Budge	1	8742	M. R. Birnbaum
1431	J. S. Peery	1	8742	J. J. Dike
1432		1	8742	L. I. Weingarten
1434	D. R. Martinez & staff	5	8743	M. L. Callabresi & staff
1500	D. J. McCloskey			
1501	C. W. Peterson			
1502	P. J. Hommert			
1511	J. S. Rottler			
1511	D. K. Gartling			
1511	M. W. Glass			
1511	P. L. Hopkins			
1511	M. J. Martinez			
1511	P. A. Sackinger			
1511	P. R. Schunk			
1511	J. D. Zepper			
1512	A. C. Ratzel			
1513	R. D. Skocypec			
1513	R. G. Baca			
1513	R. E. Hogan, Jr.			
1513	J. L. Moya			
1551	W. P. Wolfe			
1552	C. E. Hailey			
1553	W. L. Hermina			
1554	W. H. Rutledge			
1561	_			
1562				
1562	G. D. Sjaardema			
1832	J. M. Ramage			
2565	S. T. Montgomery			
6313	J. Jung			
	1400 1401 1402 1403 1404 1425 1425 1431 1431 1431 1432 1434 1500 1501 1502 1511 1511 1511 1511 1511	1401 J. R. Asay 1402 S. S. Dosanjh 1403 G. S. Davidson 1404 J. A. Ang 1425 J. H. Biffle & staff 1425 M. K. Smith 1425 M. M. Glaun 1431 J. S. Peery 1432 W. T. Brown 1431 J. S. Peery 1432 W. T. Brown 1530 D. J. McCloskey 1501 D. J. McCloskey 1502 P. J. Hommert 1511 J. S. Rottler 1511 J. S. Rottler 1511 D. K. Gartling 1511 M. J. Martinez 1511 P. A. Sackinger 1511 P. A. Sackinger 1511 P. R. Schunk 1512 A. C. Ratzel 1513 R. E. Hogan, Jr. 1513 R. E. Hogan, Jr. 1513 R. E. Hogan, Jr. <td>1400 E. L. Barsis 1 1401 J. R. Asay 1 1402 S. S. Dosanjh 5 1403 G. S. Davidson 1 1404 J. A. Ang 10 1425 J. H. Biffle & staff 1 1425 M. K. Smith 1 1431 J. M. McGlaun 6 1431 K. G. Budge 1 1431 J. S. Peery 1 1432 W. T. Brown 1 1434 D. R. Martinez & staff 5 1500 D. J. McCloskey 1 1501 C. W. Peterson 1 1502 P. J. Hommert 1 1511 J. S. Rottler 1 1511 D. K. Gartling 1 1511 M. W. Glass 1 1511 P. L. Hopkins 1 1511 P. A. Sackinger 1 1511 P. R. Schunk 1 1511 J. D. Zepper 1 1512 A. C. Ratzel 1 1513 R. D. Skocypec 1 1513 R. G. Baca 1 1513 R. E. Hogan, Jr. 1 1513 J. L. Moya 1 1551 W. P. Wolfe 1 1552 C. E. Hailey 1 1553 W. L. Hermina 1 1562 R. K. Thomas & staff 1 1562 R. K. Thomas & staff 1 1562 G. D. Sjaardema 1 1832 J. M. Ramage 2 1565 S. T. Montgomery 100 100 100 100 100 100 100 100 100 10</td> <td>1 6423 1400 E. L. Barsis 1 6513 1401 J. R. Asay 1 6522 1402 S. S. Dosanjh 5 7141 1403 G. S. Davidson 1 7151 1404 J. A. Ang 10 7613-2 1425 J. H. Biffle & staff 1425 M. K. Smith 1 8523-2 1431 J. M. McGlaun 6 8741 1431 K. G. Budge 1 8742 1431 J. S. Peery 1 8742 1432 W. T. Brown 1 8742 1434 D. R. Martinez & staff 5 8743 1500 D. J. McCloskey 1501 C. W. Peterson 1502 P. J. Hommert 1511 J. S. Rottler 1511 D. K. Gartling 1511 M. W. Glass 1511 P. L. Hopkins 1511 M. J. Martinez 1511 P. A. Sackinger 1511 P. R. Schunk 1511 J. D. Zepper 1512 A. C. Ratzel 1513 R. D. Skocypec 1513 R. G. Baca 1513 R. E. Hogan, Jr. 1513 J. L. Moya 1551 W. P. Wolfe 1552 C. E. Hailey 1553 W. L. Hermina 1554 W. H. Rutledge 1561 H. S. Morgan & staff 1562 R. K. Thomas & staff 1562 G. D. Sjaardema 1832 J. M. Ramage 2565 S. T. Montgomery</td>	1400 E. L. Barsis 1 1401 J. R. Asay 1 1402 S. S. Dosanjh 5 1403 G. S. Davidson 1 1404 J. A. Ang 10 1425 J. H. Biffle & staff 1 1425 M. K. Smith 1 1431 J. M. McGlaun 6 1431 K. G. Budge 1 1431 J. S. Peery 1 1432 W. T. Brown 1 1434 D. R. Martinez & staff 5 1500 D. J. McCloskey 1 1501 C. W. Peterson 1 1502 P. J. Hommert 1 1511 J. S. Rottler 1 1511 D. K. Gartling 1 1511 M. W. Glass 1 1511 P. L. Hopkins 1 1511 P. A. Sackinger 1 1511 P. R. Schunk 1 1511 J. D. Zepper 1 1512 A. C. Ratzel 1 1513 R. D. Skocypec 1 1513 R. G. Baca 1 1513 R. E. Hogan, Jr. 1 1513 J. L. Moya 1 1551 W. P. Wolfe 1 1552 C. E. Hailey 1 1553 W. L. Hermina 1 1562 R. K. Thomas & staff 1 1562 R. K. Thomas & staff 1 1562 G. D. Sjaardema 1 1832 J. M. Ramage 2 1565 S. T. Montgomery 100 100 100 100 100 100 100 100 100 10	1 6423 1400 E. L. Barsis 1 6513 1401 J. R. Asay 1 6522 1402 S. S. Dosanjh 5 7141 1403 G. S. Davidson 1 7151 1404 J. A. Ang 10 7613-2 1425 J. H. Biffle & staff 1425 M. K. Smith 1 8523-2 1431 J. M. McGlaun 6 8741 1431 K. G. Budge 1 8742 1431 J. S. Peery 1 8742 1432 W. T. Brown 1 8742 1434 D. R. Martinez & staff 5 8743 1500 D. J. McCloskey 1501 C. W. Peterson 1502 P. J. Hommert 1511 J. S. Rottler 1511 D. K. Gartling 1511 M. W. Glass 1511 P. L. Hopkins 1511 M. J. Martinez 1511 P. A. Sackinger 1511 P. R. Schunk 1511 J. D. Zepper 1512 A. C. Ratzel 1513 R. D. Skocypec 1513 R. G. Baca 1513 R. E. Hogan, Jr. 1513 J. L. Moya 1551 W. P. Wolfe 1552 C. E. Hailey 1553 W. L. Hermina 1554 W. H. Rutledge 1561 H. S. Morgan & staff 1562 R. K. Thomas & staff 1562 G. D. Sjaardema 1832 J. M. Ramage 2565 S. T. Montgomery

THIS PAGE INTENTIONALLY LEFT BLANK